


# H-53 WIRING SYSTEM AWARENESS

## PREVENTING WIRING SYSTEM FAILURE SAVES TIME, MONEY...


AND LIVES!



Connector improperly protected and stowed. Plastic bags promote condensation, which promotes corrosion. Connector zip tied to cross bar, but should have been wrapped with self-adhesive tape and then butterfly clamped to the cross bar.

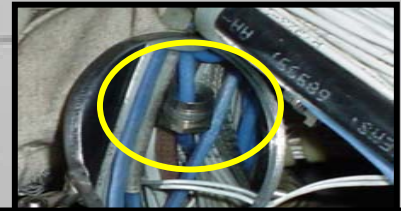


Connector back shell not attached to the connector causing chafing condition.

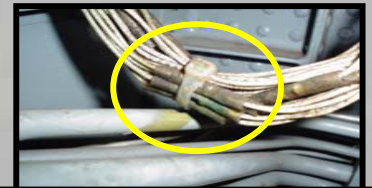

Old style window splice. Middle splice is green from corrosion. Zip ties placed over splices induce strain.

Oversized clamp does not properly support the wiring.

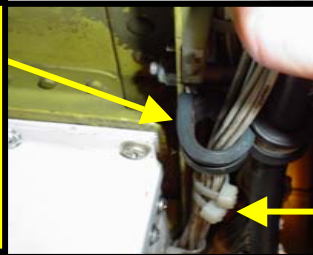

Loose zip ties wearing on the wiring.

## ALWAYS MAINTAIN THE CORRECT WIRING SYSTEM CONFIGURATION !